



Company: Raydon Exploration, Inc


Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE
August
04
2017

DST #6 **Formation: Marmaton** **Test Interval: 5045 - 5078'** **Total Depth: 5078'**
Time On: 10:51 08/04 Time Off: 16:05 08/04
Time On Bottom: 00:00 08/04 Time Off Bottom: 00:00 08/04

Electronic Volume Estimate: 0'
1st Open 1st Close 2nd Open 2nd Close
N/A N/A N/A N/A

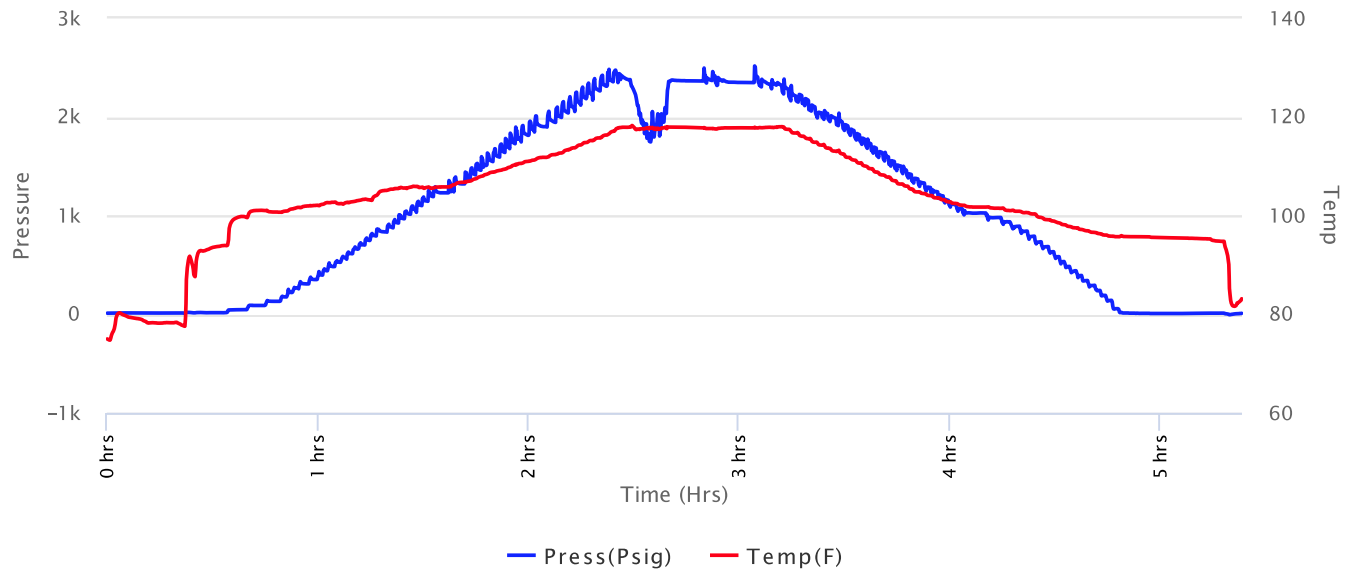



Company: Raydon Exploration, Inc

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
 County: SEWARD
 State: Kansas
 Drilling Contractor: Quest Drilling Services, LLC - Rig 102
 Elevation: 2750 KB
 Field Name: Kismet
 Pool: WILDCAT
 Job Number: 21

DATE
August
04
2017

DST #6 **Formation: Marmaton** **Test Interval: 5045 - 5078'** **Total Depth: 5078'**

Time On: 10:51 08/04 Time Off: 16:05 08/04
 Time On Bottom: 00:00 08/04 Time Off Bottom: 00:00 08/04

Recovered


Foot	BBLs
2100	27.3868028

Description of Fluid	Gas %	Oil %	Water %	Mud %
M	0	0	0	100

Total Recovered: 2100 ft
 Total Barrels Recovered: 27.3868028

Reversed Out
YES

Recovery at a glance

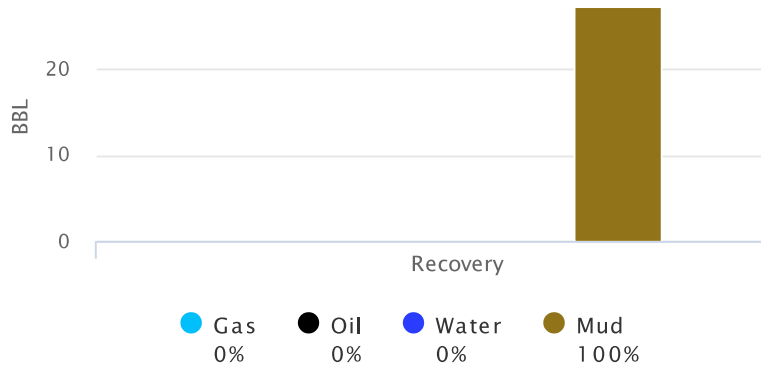

Initial Hydrostatic Pressure	0	PSI
Initial Flow	0	PSI
Initial Closed in Pressure	0	PSI
Final Flow Pressure	0	PSI
Final Closed in Pressure	0	PSI
Final Hydrostatic Pressure	0	PSI
Temperature	0	°F
Pressure Change Initial Close / Final Close	0.0	%



**Company: Raydon Exploration,
Inc**

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling
Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #6	Formation: Marmaton	Test Interval: 5045 - 5078'	Total Depth: 5078'
	Time On: 10:51 08/04	Time Off: 16:05 08/04	
	Time On Bottom: 00:00 08/04	Time Off Bottom: 00:00 08/04	

REMARKS:

MISRUN! There must have been a little weight on the tool while we broke the top joint off and made up the head.

Dropped the bar on the trip out, so we wouldn't have to dump mud.



Company: Raydon Exploration, Inc

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #6 **Formation:** Marmaton **Test Interval: 5045 - 5078'** **Total Depth: 5078'**
Time On: 10:51 08/04 Time Off: 16:05 08/04
Time On Bottom: 00:00 08/04 Time Off Bottom: 00:00 08/04

Down Hole Makeup

Heads Up: 35.19 FT	Packer 1: 5039.5 FT
Drill Pipe: 4779 FT <i>ID-3 1/2</i>	Packer 2: 5045 FT
Weight Pipe: 0 FT <i>ID-2 7/8</i>	Top Recorder: 5028.92 FT
Collars: 268.12 FT <i>ID-2 1/4</i>	Bottom Recorder: 5048 FT
Test Tool: 34.07 FT <i>ID-3 1/2-FH</i> <i>Jars</i> <i>Safety Joint</i>	Well Bore Size: 7 7/8
Total Anchor: 33	Surface Choke: 1"
Anchor Makeup	Bottom Choke: 5/8"
Packer Sub: 1 FT	
Perforations: (top): 1 FT <i>4 1/2-FH</i>	
Change Over: FT	
Drill Pipe: (in anchor): FT <i>ID-3 1/2</i>	
Change Over: FT	
Perforations: (below): 31 FT <i>4 1/2-FH</i>	



**Company: Raydon Exploration,
Inc**

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling
Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #6	Formation: Marmaton	Test Interval: 5045 - 5078'	Total Depth: 5078'
	Time On: 10:51 08/04	Time Off: 16:05 08/04	
	Time On Bottom: 00:00 08/04	Time Off Bottom: 00:00 08/04	

Mud Properties

Mud Type: Chemical **Weight:** 8.9 **Viscosity:** 57 **Filtrate:** 6.4 **Chlorides:** 5500 ppm