



Company: Raydon Exploration, Inc

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
 County: SEWARD
 State: Kansas
 Drilling Contractor: Quest Drilling Services, LLC - Rig 102
 Elevation: 2750 KB
 Field Name: Kismet
 Pool: WILDCAT
 Job Number: 21

DATE
August
04
2017

DST #7	Formation: Marmaton	Test Interval: 5045 - 5078'	Total Depth: 5078'
Time On: 16:12 08/04	Time Off: 01:49 08/05		
Time On Bottom: 18:38 08/04	Time Off Bottom: 22:38 08/04		


Electronic Volume Estimate:
48'

1st Open
Minutes: 30
.5" at 30 min

1st Close
Minutes: 60
0" at 60 min

2nd Open
Minutes: 30
.75" at 30 min

2nd Close
Minutes: 120
0" at 120 min

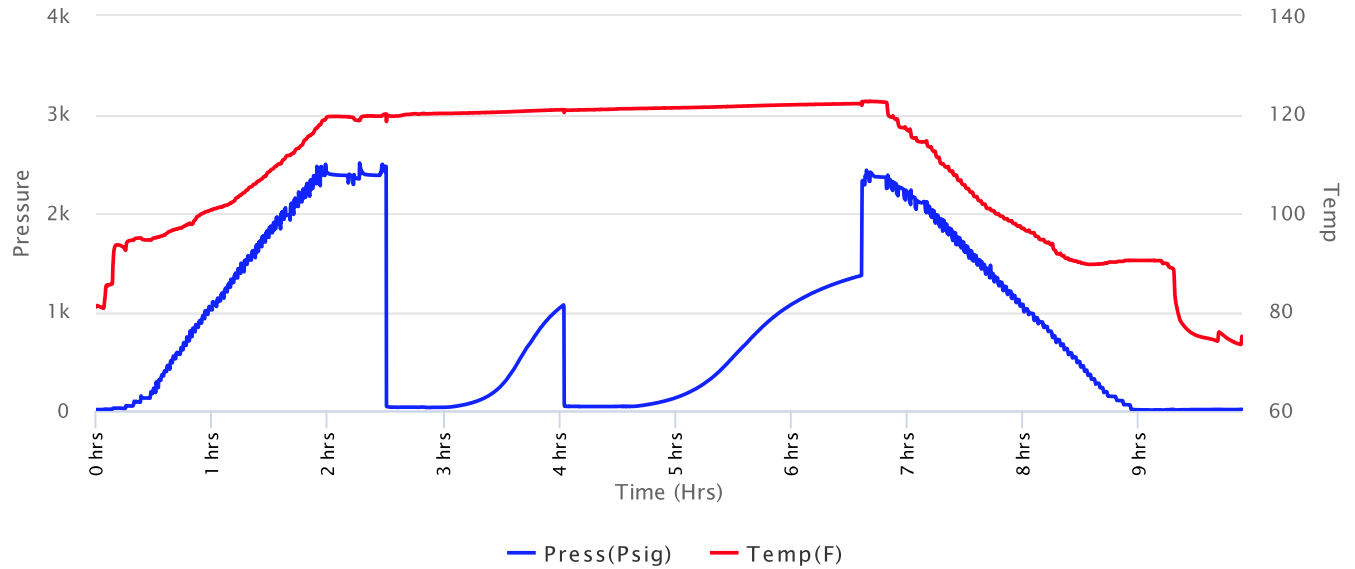



Company: Raydon Exploration, Inc

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
 County: SEWARD
 State: Kansas
 Drilling Contractor: Quest Drilling Services, LLC - Rig 102
 Elevation: 2750 KB
 Field Name: Kismet
 Pool: WILDCAT
 Job Number: 21

DATE
 August
04
 2017

DST #7 **Formation: Marmaton** **Test Interval: 5045 - 5078'** **Total Depth: 5078'**
 Time On: 16:12 08/04 Time Off: 01:49 08/05
 Time On Bottom: 18:38 08/04 Time Off Bottom: 22:38 08/04

Recovered


<u>Foot</u>	<u>BBLs</u>	<u>Description of Fluid</u>	<u>Gas %</u>	<u>Oil %</u>	<u>Water %</u>	<u>Mud %</u>
50	0.246	M	0	0	0	100

Total Recovered: 50 ft
 Total Barrels Recovered: 0.246

Reversed Out
 NO

Initial Hydrostatic Pressure	2383	PSI
Initial Flow	34 to 35	PSI
Initial Closed in Pressure	1070	PSI
Final Flow Pressure	42 to 43	PSI
Final Closed in Pressure	1370	PSI
Final Hydrostatic Pressure	2375	PSI
Temperature	123	°F
Pressure Change Initial Close / Final Close	0.0	%

Recovery at a glance

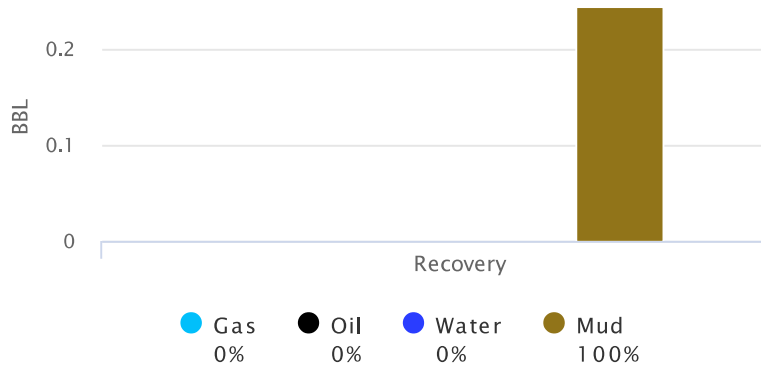



**Company: Raydon Exploration,
Inc**

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling
Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #7

**Formation:
Marmaton**

**Test Interval: 5045 -
5078' Total Depth: 5078'**

Time On: 16:12 08/04

Time Off: 01:49 08/05

Time On Bottom: 18:38 08/04 Time Off Bottom: 22:38 08/04

REMARKS:

Initial Flow: Surface blow increasing to .5".

Final Flow: Surface blow increasing to .75". Died.



Company: Raydon Exploration, Inc

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #7 **Formation: Marmaton** **Test Interval: 5045 - 5078'** **Total Depth: 5078'**
Time On: 16:12 08/04 Time Off: 01:49 08/05
Time On Bottom: 18:38 08/04 Time Off Bottom: 22:38 08/04

Down Hole Makeup

Heads Up: 35.07 FT	Packer 1: 5039.5 FT
Drill Pipe: 4779 FT <i>ID-3 1/2</i>	Packer 2: 5045 FT
Weight Pipe: 0 FT <i>ID-2 7/8</i>	Top Recorder: 5028.92 FT
Collars: 268 FT <i>ID-2 1/4</i>	Bottom Recorder: 1 FT
Test Tool: 34.07 FT <i>ID-3 1/2-FH</i> <i>Jars</i> <i>Safety Joint</i>	Well Bore Size: 7 7/8
Total Anchor: 33	Surface Choke: 1"
Anchor Makeup	Bottom Choke: 5/8"
Packer Sub: 1 FT	
Perforations: (top): 1 FT <i>4 1/2-FH</i>	
Change Over: FT	
Drill Pipe: (in anchor): FT <i>ID-3 1/2</i>	
Change Over: FT	
Perforations: (below): 31 FT <i>4 1/2-FH</i>	



**Company: Raydon Exploration,
Inc**

Lease: Linda Jo #1-22

SEC: 22 TWN: 33S RNG: 31W
County: SEWARD
State: Kansas
Drilling Contractor: Quest Drilling
Services, LLC - Rig 102
Elevation: 2750 KB
Field Name: Kismet
Pool: WILDCAT
Job Number: 21

DATE August 04 2017
--

DST #7	Formation: Marmaton	Test Interval: 5045 - 5078'	Total Depth: 5078'
	Time On: 16:12 08/04	Time Off: 01:49 08/05	
	Time On Bottom: 18:38 08/04	Time Off Bottom: 22:38 08/04	

Mud Properties

Mud Type: Chemical **Weight:** 8.9 **Viscosity:** 57 **Filtrate:** 6.4 **Chlorides:** 5500 ppm